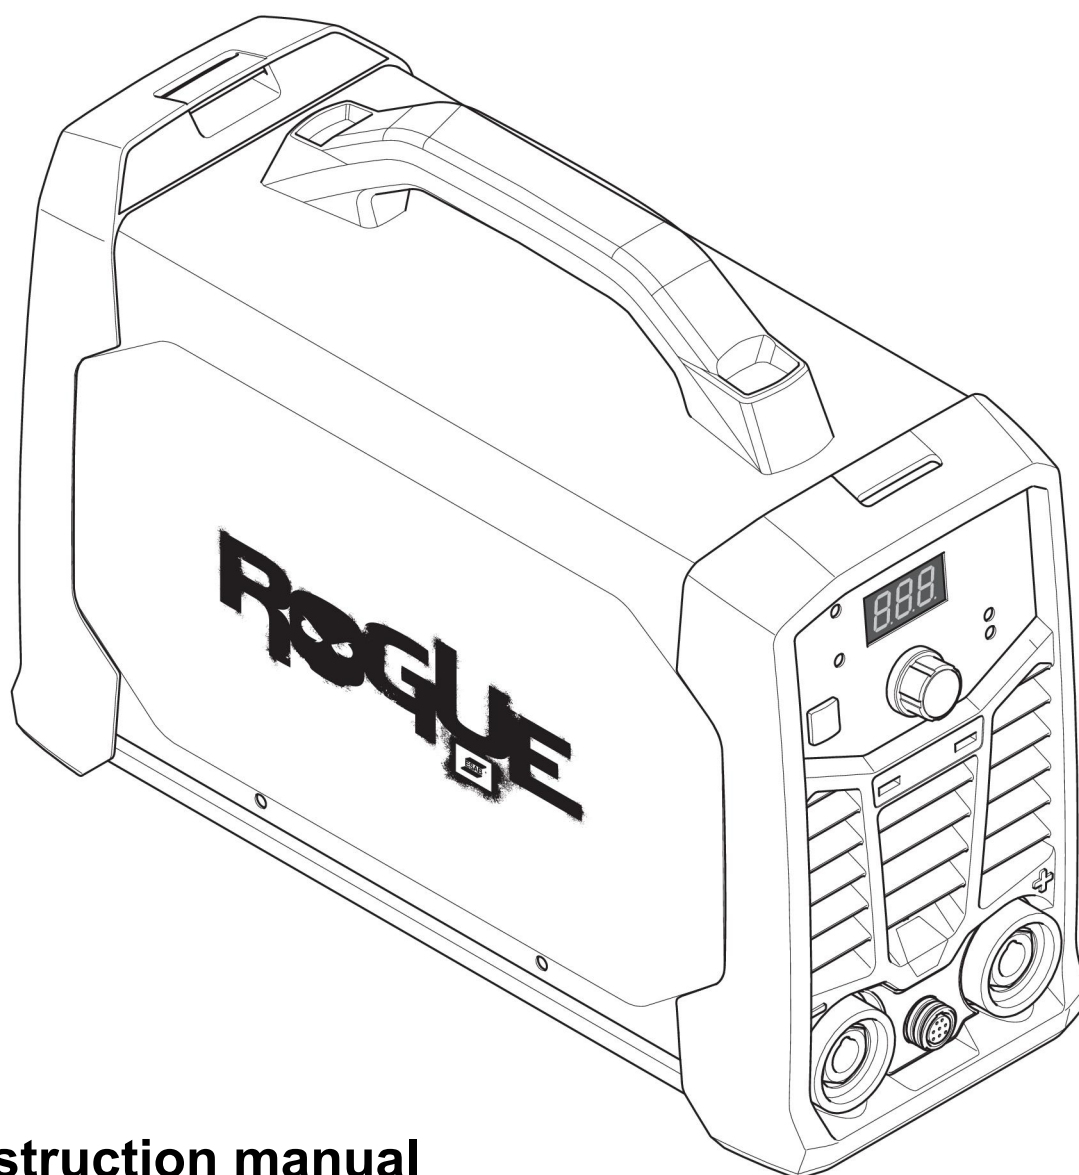




Rogue

ES 180i Pro, ES 200i Pro



Instruction manual



EU DECLARATION OF CONFORMITY

According to
The Low Voltage Directive 2014/35/EU
The EMC Directive 2014/30/EU
The RoHS Directive 2011/65/EU

Type of equipment

Welding power source

Type designation

ES 200i Pro serial number starting with A01
ES 180i Pro serial number starting with A01

Brand name or trademark

ESAB

Manufacturer or his authorised representative established within the EEA**Name, address, and telephone No:**

ESAB AB
Lindholmsallén 9, Box 8004, SE-402 77 Göteborg, Sweden
Phone: +46 31 50 90 00, www.esab.com

The following harmonised standards in force within the EEA has been used in the design:

EN 60974-1:2012, Arc Welding Equipment – Part 1: Welding Power Sources
EN 60974-10:2014, A1:2015, Arc Welding Equipment – Part 10: Electromagnetic Compatibility
(EMC) requirements

Additional Information:

Restrictive use, Class A equipment, intended for use in location other than residential

By signing this document, the undersigned declares as manufacturer, or the manufacturer's authorised representative established within the EEA, that the equipment in question complies with the safety requirements stated above.

Place/Date

Göteborg
2020-01-09

Signature

Pedro Muniz
Standard Equipment Director

CE 2020

TABLE OF CONTENTS

| | | |
|----------|-----------------------------------|-----------|
| 1 | SAFETY | 4 |
| 1.1 | Meaning of symbols | 4 |
| 1.2 | Safety precautions | 4 |
| 2 | INTRODUCTION | 8 |
| 2.1 | Equipment | 8 |
| 3 | TECHNICAL DATA | 9 |
| 4 | INSTALLATION | 11 |
| 4.1 | Location | 11 |
| 4.2 | Lifting instructions | 11 |
| 4.3 | Mains supply | 12 |
| 5 | MAINTENANCE | 14 |
| 5.1 | Routine maintenance | 14 |
| 5.2 | Cleaning instruction | 14 |
| 6 | TROUBLESHOOTING | 16 |
| 7 | ORDERING SPARE PARTS | 17 |
| | DIAGRAM | 18 |
| | ORDERING NUMBERS | 19 |
| | ACCESSORIES | 20 |

1 SAFETY

1.1 Meaning of symbols

As used throughout this manual: Means Attention! Be Alert!

**DANGER!**

Means immediate hazards which, if not avoided, will result in immediate, serious personal injury or loss of life.

**WARNING!**

Means potential hazards which could result in personal injury or loss of life.

**CAUTION!**

Means hazards which could result in minor personal injury.

**WARNING!**

Before use, read and understand the instruction manual and follow all labels, employer's safety practices and Safety Data Sheets (SDSs).



1.2 Safety precautions

Users of ESAB equipment have the ultimate responsibility for ensuring that anyone who works on or near the equipment observes all the relevant safety precautions. Safety precautions must meet the requirements that apply to this type of equipment. The following recommendations should be observed in addition to the standard regulations that apply to the workplace.

All work must be carried out by trained personnel well-acquainted with the operation of the equipment. Incorrect operation of the equipment may lead to hazardous situations which can result in injury to the operator and damage to the equipment.

1. Anyone who uses the equipment must be familiar with:
 - its operation
 - location of emergency stops
 - its function
 - relevant safety precautions
 - welding and cutting or other applicable operation of the equipment
2. The operator must ensure that:
 - no unauthorised person is stationed within the working area of the equipment when it is started up
 - no-one is unprotected when the arc is struck or work is started with the equipment
3. The workplace must:
 - be suitable for the purpose
 - be free from drafts

4. Personal safety equipment:
 - Always wear recommended personal safety equipment, such as safety glasses, flame-proof clothing, safety gloves
 - Do not wear loose-fitting items, such as scarves, bracelets, rings, etc., which could become trapped or cause burns
5. General precautions:
 - Make sure the return cable is connected securely
 - Work on high voltage equipment **may only be carried out by a qualified electrician**
 - Appropriate fire extinguishing equipment must be clearly marked and close at hand
 - Lubrication and maintenance must **not** be carried out on the equipment during operation

If equipped with ESAB cooler

Use ESAB approved coolant only. Non-approved coolant might damage the equipment and jeopardize product safety. In case of such damage, all warranty undertakings from ESAB cease to apply.

Recommended ESAB coolant ordering number: 0465 720 002.

For ordering information, see the "ACCESSORIES" chapter in the instruction manual.



WARNING!

Arc welding and cutting can be injurious to yourself and others. Take precautions when welding and cutting.



ELECTRIC SHOCK - Can kill

- Install and ground the unit in accordance with instruction manual.
- Do not touch live electrical parts or electrodes with bare skin, wet gloves or wet clothing.
- Insulate yourself from work and ground.
- Ensure your working position is safe



ELECTRIC AND MAGNETIC FIELDS - Can be dangerous to health

- Welders having pacemakers should consult their physician before welding. EMF may interfere with some pacemakers.
- Exposure to EMF may have other health effects which are unknown.
- Welders should use the following procedures to minimize exposure to EMF:
 - Route the electrode and work cables together on the same side of your body. Secure them with tape when possible. Do not place your body between the torch and work cables. Never coil the torch or work cable around your body. Keep welding power source and cables as far away from your body as possible.
 - Connect the work cable to the workpiece as close as possible to the area being welded.



FUMES AND GASES - Can be dangerous to health

- Keep your head out of the fumes.
- Use ventilation, extraction at the arc, or both, to take fumes and gases away from your breathing zone and the general area.



ARC RAYS - Can injure eyes and burn skin

- Protect your eyes and body. Use the correct welding screen and filter lens and wear protective clothing.
- Protect bystanders with suitable screens or curtains.



NOISE - Excessive noise can damage hearing

Protect your ears. Use earmuffs or other hearing protection.



MOVING PARTS - Can cause injuries

- Keep all doors, panels and covers closed and securely in place. Have only qualified people remove covers for maintenance and troubleshooting as necessary. Reinstall panels or covers and close doors when service is finished and before starting engine.
- Stop engine before installing or connecting unit.
- Keep hands, hair, loose clothing and tools away from moving parts.



FIRE HAZARD

- Sparks (spatter) can cause fire. Make sure that there are no inflammable materials nearby.
- Do not use on closed containers.



HOT SURFACE - Parts can burn

- Do not touch parts bare handed.
- Allow cooling period before working on equipment.
- To handle hot parts, use proper tools and/or insulated welding gloves to prevent burns.

MALFUNCTION - Call for expert assistance in the event of malfunction.

PROTECT YOURSELF AND OTHERS!



CAUTION!

This product is solely intended for arc welding.



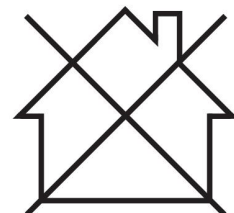
WARNING!

Do not use the power source for thawing frozen pipes.



CAUTION!

Class A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. There may be potential difficulties in ensuring electromagnetic compatibility of class A equipment in those locations, due to conducted as well as radiated disturbances.






NOTE!

Dispose of electronic equipment at the recycling facility!

In observance of European Directive 2012/19/EC on Waste Electrical and Electronic Equipment and its implementation in accordance with national law, electrical and/or electronic equipment that has reached the end of its life must be disposed of at a recycling facility.

As the person responsible for the equipment, it is your responsibility to obtain information on approved collection stations.

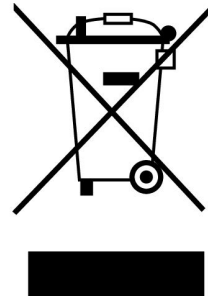For further information contact the nearest ESAB dealer.



ESAB has an assortment of welding accessories and personal protection equipment for purchase. For ordering information contact your local ESAB dealer or visit us on our website.

2 INTRODUCTION

Overview

Rogue ES 180i Pro, ES 200i Pro is an inverter-based power source intended for MMA (Manual Metal Arc) and TIG (Tungsten Inert Gas) welding.

ESAB accessories for the product can be found in the "ACCESSORIES" chapter of this manual.

2.1 Equipment

Rogue ES 180i Pro, ES 200i Pro includes:

- Power Source
- Work Clamp Leadset
- Electrode Holder Leadset
- Safety Manual
- Quick Start Guide
- Shoulder Strap

3 TECHNICAL DATA

Technical data

| | Rogue ES 200i Pro | | Rogue ES 180i Pro | |
|--|-------------------|------------------|-------------------|----------------|
| Outlet voltage | 230 V±15% | 115 V±15% | 230 V±15% | 115 V±15% |
| | 1~ 50/60 Hz | 1~ 50/60 Hz | 1~ 50/60 Hz | 1~ 50/60 Hz |
| Primary current | | | | |
| I_{\max} MMA | 30 A | 29 A | 26 A | 29 A |
| I_{\max} Live TIG | 19.5 A | 24 A | 16.5 A | 24 A |
| No-load power demand when in energy saving mode | 50 W | 50 W | 50 W | 50 W |
| Setting range | | | | |
| MMA | 20-200 A | 20-110 A | 20-180 A | 20-110 A |
| Live TIG | 10-200 A | 10-140 A | 10-180 A | 10-140 A |
| Permissible load at MMA | | | | |
| 25% duty cycle | 200 A / 28 V | 110 A / 24.4 V | 180 A / 27.2 V | 110 A / 24.4 V |
| 60% duty cycle | 129 A / 25.2 V | 70 A / 22.8 V | 116 A / 24.6 V | 70 A / 22.8 V |
| 100% duty cycle | 100 A / 24 V | 55 A / 22.2 V | 90 A / 23.6 V | 55 A / 22.2 V |
| Permissible load at Live TIG | | | | |
| 25% duty cycle | 200 A / 18 V | 140 A / 15.6 V | 180 A / 17.2 V | 140 A / 15.6 V |
| 60% duty cycle | 129 A / 15.2 V | 90 A / 13.6 V | 116 A / 14.6 V | 90 A / 13.6 V |
| 100% duty cycle | 100 A / 14 V | 70 A / 12.8 V | 90 A / 13.6 V | 70 A / 12.8 V |
| Apparent power I_2 at maximum current | 6.9 kVA | 3.3 kVA | 6 kVA | 3.3 kVA |
| Active power I_2 at maximum current | 6.8 kW | 3.26 kW | 5.94 kW | 3.26 kW |
| Power factor at maximum current | | | | |
| Live TIG | 0.99 | 0.99 | 0.99 | 0.99 |
| MMA | 0.99 | 0.99 | 0.99 | 0.99 |
| Efficiency at maximum current | | | | |
| MMA | 82% | 82% | 82% | 82% |
| Live TIG | 82% | 82% | 82% | 82% |
| Open-circuit voltage U_0 max | | | | |
| VRD 35 V deactivated | 78 V DC | 78 V DC | 78 V DC | 78 V DC |
| VRD 35 V activated | <30 V | <30 V | <30 V | <30 V |

| | Rogue ES 200i Pro | | Rogue ES 180i Pro | |
|--|---|---|---|---|
| Operating temperature | -10 to +40 °C (+14 to 104 °F) | -10 to +40 °C (+14 to 104 °F) | -10 to +40 °C (+14 to 104 °F) | -10 to +40 °C (+14 to 104 °F) |
| Transportation temperature | -20 to +55 °C (-4 to +131 °F) | -20 to +55 °C (-4 to +131 °F) | -20 to +55 °C (-4 to +131 °F) | -20 to +55 °C (-4 to +131 °F) |
| Continual sound pressure at no-load | <70 dB | <70 dB | <70 dB | <70 dB |
| Dimensions l × w × h | 403×153×264 mm (15.8 × 6 × 10.4 in.) | 403×153×264 mm (15.8 × 6 × 10.4 in.) | 403×153×264 mm (15.8 × 6 × 10.4 in.) | 403×153×264 mm (15.8 × 6 × 10.4 in.) |
| Weight | 8.4 kg | 8.4 kg | 8.4 kg | 8.4 kg |
| Insulation class transformer | H | H | H | H |
| Enclosure class | IP23S | IP23S | IP23S | IP23S |
| Application class | S | S | S | S |

Mains supply, $S_{sc \min}$

Minimum short circuit power on the network in accordance with IEC 61000-3-12.

Duty cycle

The duty cycle refers to the time as a percentage of a ten-minute period that you can weld or cut at a certain load without overloading. The duty cycle is valid for 40 °C / 104 °F, or below.

Enclosure class

The **IP** code indicates the enclosure class, i.e. the degree of protection against penetration by solid objects or water.

Equipment marked **IP23S** is intended for indoor and outdoor use; however, should not be operated in precipitation.

Application class

The symbol **S** indicates that the power source is designed for use in areas with increased electrical hazard.

4 INSTALLATION

The installation must be carried out by a professional.

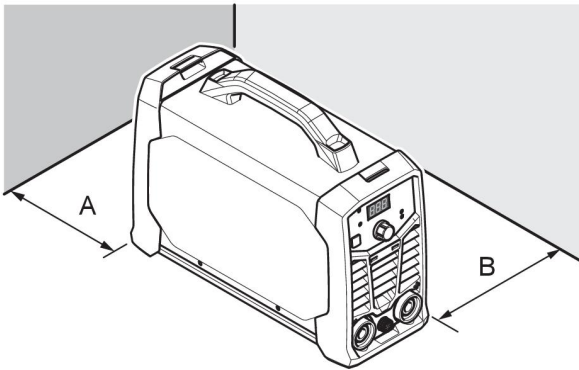


CAUTION!

This product is intended for industrial use. In a domestic environment this product may cause radio interference. It is the user's responsibility to take adequate precautions.

4.1 Location

Position the power source so that cooling air inlets and outlets are not obstructed.



A. Minimum 200 mm (8 in.)

B. Minimum 200 mm (8 in.)



WARNING!

Secure the equipment - particularly if the ground is uneven or sloping.

4.2 Lifting instructions

These units are equipped with a handle for carrying purposes.



WARNING!

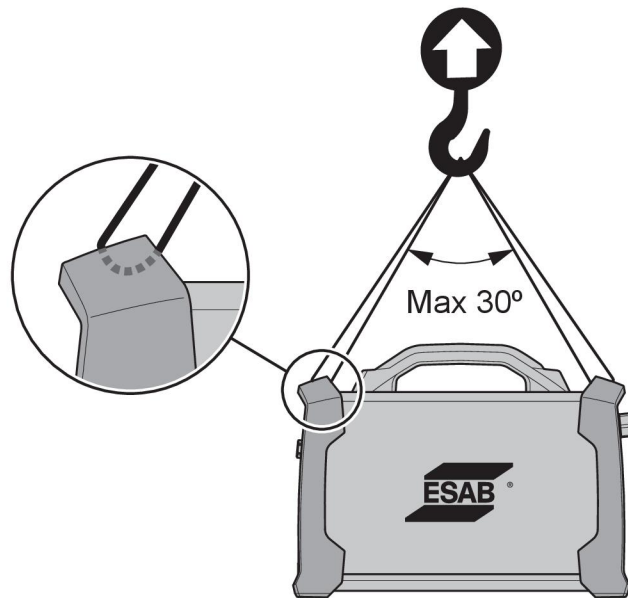
Electric shock can kill. Do not touch live electrical parts. Disconnect input power conductors from de-energized supply line before moving the welding power source.



WARNING!

Falling equipment can cause serious personal injury and equipment damage.

Lift the unit with handle on top of case.



4.3 Mains supply

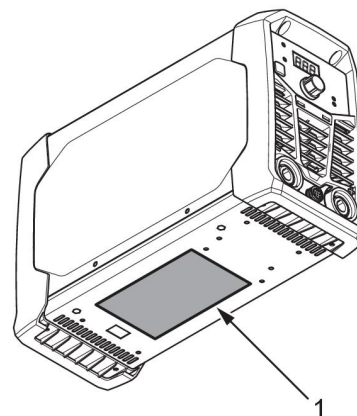


NOTE!

Rogue ES 180i Pro and ES 200i Pro comply with IEC 61000-3-12 provided that the short-circuit power is greater than or equal to S_{scmin} at the interface point between the user's supply and the public system. It is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment is connected only to a supply with a short-circuit power greater than or equal to S_{scmin} . Refer to the technical data in the TECHNICAL DATA chapter.

The power source will automatically adjust to the supplied input voltage. Make sure that it is protected by the correct fuse rating. A protective ground connection must be made, in accordance with regulations.

1. Rating plate with supply connection data.



| Recommended fuse sizes and minimum cable area for the ES 180i Pro, ES 200i Pro | | |
|--|---------------------|---------------------|
| Supply voltage | 230 VAC | 115 VAC |
| Electrical cable area | 2.5 mm ² | 2.5 mm ² |
| Maximal current rating | | |
| I_{max} MMA/Stick (SMAW) | 30 A | 29 A |

| Recommended fuse sizes and minimum cable area for the ES 180i Pro, ES 200i Pro | | |
|---|------|--------|
| I_{eff} MMA/Stick (SMAW) | 15 A | 14.5 A |
| Fuse anti-surge type D MCB | 20 A | 20 A |

| Recommended fuse sizes and minimum cable area for the ES 180i Pro, ES 200i Pro | | |
|---|-------------------|-------------------|
| Supply voltage | 230 VAC | 115 VAC |
| Maximum recommended extension cord length | 100 m (328 ft) | 100 m (328 ft) |
| Minimum recommended extension cord size | 4 mm ² | 4 mm ² |

**NOTE!**

Different variants of **ES 180i Pro, ES 200i Pro** are certified for different outlet voltages. Always refer to the rating plate for the specification of the power source in use.

**NOTE!**

Use the power source in accordance with the relevant national regulations.

Supply from power generators

The power source can be supplied from different types of generators. However, some generators may not provide sufficient power for the welding power source to operate correctly. Generators with Automatic Voltage Regulation (AVR) or with equivalent or better type of regulation, with rated power 7 kW, are recommended.

5 MAINTENANCE



WARNING!

The mains supply must be disconnected during cleaning and maintenance.



CAUTION!

Only persons with the appropriate electrical knowledge (authorised personnel) may remove the safety plates.



NOTE!

Regular maintenance is important for safe and reliable operation.



NOTE!



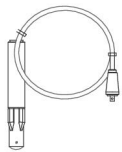

Perform maintenance more often during severe dusty conditions.

Before each use - make sure that:

- Product and cables are not damaged,
- The torch is clean and not damaged.

5.1 Routine maintenance

Maintenance schedule during normal conditions. Check equipment prior to every use.

| Interval | Area to maintain | | |
|----------------|--|---|--|
| Every 3 months |  Clean or replace unreadable labels. |  Clean weld terminals. |  Check or replace weld cables. |
| Every 6 months |  Clean inside equipment. Use dry compressed air with reduced pressure. | | |

5.2 Cleaning instruction

To maintain the performance and increase the lifetime of the power source it is mandatory to clean it regularly. How often depends on:

- the welding process
- the arc time
- the working environment



CAUTION!

Make sure that the cleaning procedure is done in a suitable prepared workspace.



CAUTION!

During cleaning, always wear recommended personal safety equipment, such as ear plugs, safety glasses, masks, gloves and safety shoes.

1. Disconnect the power source from the mains supply.
2. Open the enclosure and use a vacuum cleaner to remove any accumulated dirt, metal filings, slag and loose material. Keep the shunt and lead screw surfaces clean as accumulated foreign material may reduce the welders output welding current.

6 TROUBLESHOOTING

Perform these checks and inspections before sending for an authorised service technician.

- Check that the mains voltage is disconnected before starting any type of repair action.

| Type of fault | Corrective action |
|---|---|
| MMA welding problems | Check the welding process is set for MMA. |
| | Check that the welding and return cables are correctly connected to the power source. |
| | Make sure that the return clamp has good contact with the workpiece. |
| | Check that the correct electrodes and polarity are being used. For polarity, check electrode packaging. |
| | Check that the correct Welding current (A) is set. |
| | Adjust Arc Force and Hot start. |
| TIG welding problems | Check the welding process is set for Live TIG as necessary. |
| | Check that the TIG torch and return cables are correctly connected to the power source. |
| | Make sure that the return clamp has good contact with the workpiece. |
| | Make sure that the TIG torch lead is connected to the negative welding terminal. |
| | Make sure that the correct shielding gas, gas flow, welding current, filler rod placement, electrode diameter and welding mode on power source is used. |
| | Make sure that the gas valve on the TIG torch is ON. |
| No arc | Check that the electrical power supply switch is turned on. |
| | Check that the display is on to verify that the power source has power. |
| | Check that the setting panel is displaying correct values. |
| | Check that the welding and return cables are correctly connected. |
| | Check the electrical power supply fuses. |
| Welding current is interrupted during welding | Check whether the Over Temperature LED (Thermal Protection) on the setting panel is on. |
| | Continue with Troubleshooting "No Arc". |
| The thermal protection trips frequently | Make sure that the recommended duty cycle for the weld current has not been exceeded. |
| | Refer to power source "Duty cycle" section in <i>"TECHNICAL DATA"</i> , page 9. |
| | Make sure that the air inlets or outlets are not clogged. |
| | Clean the inside of the machine using routine maintenance methods. |

7 ORDERING SPARE PARTS



CAUTION!

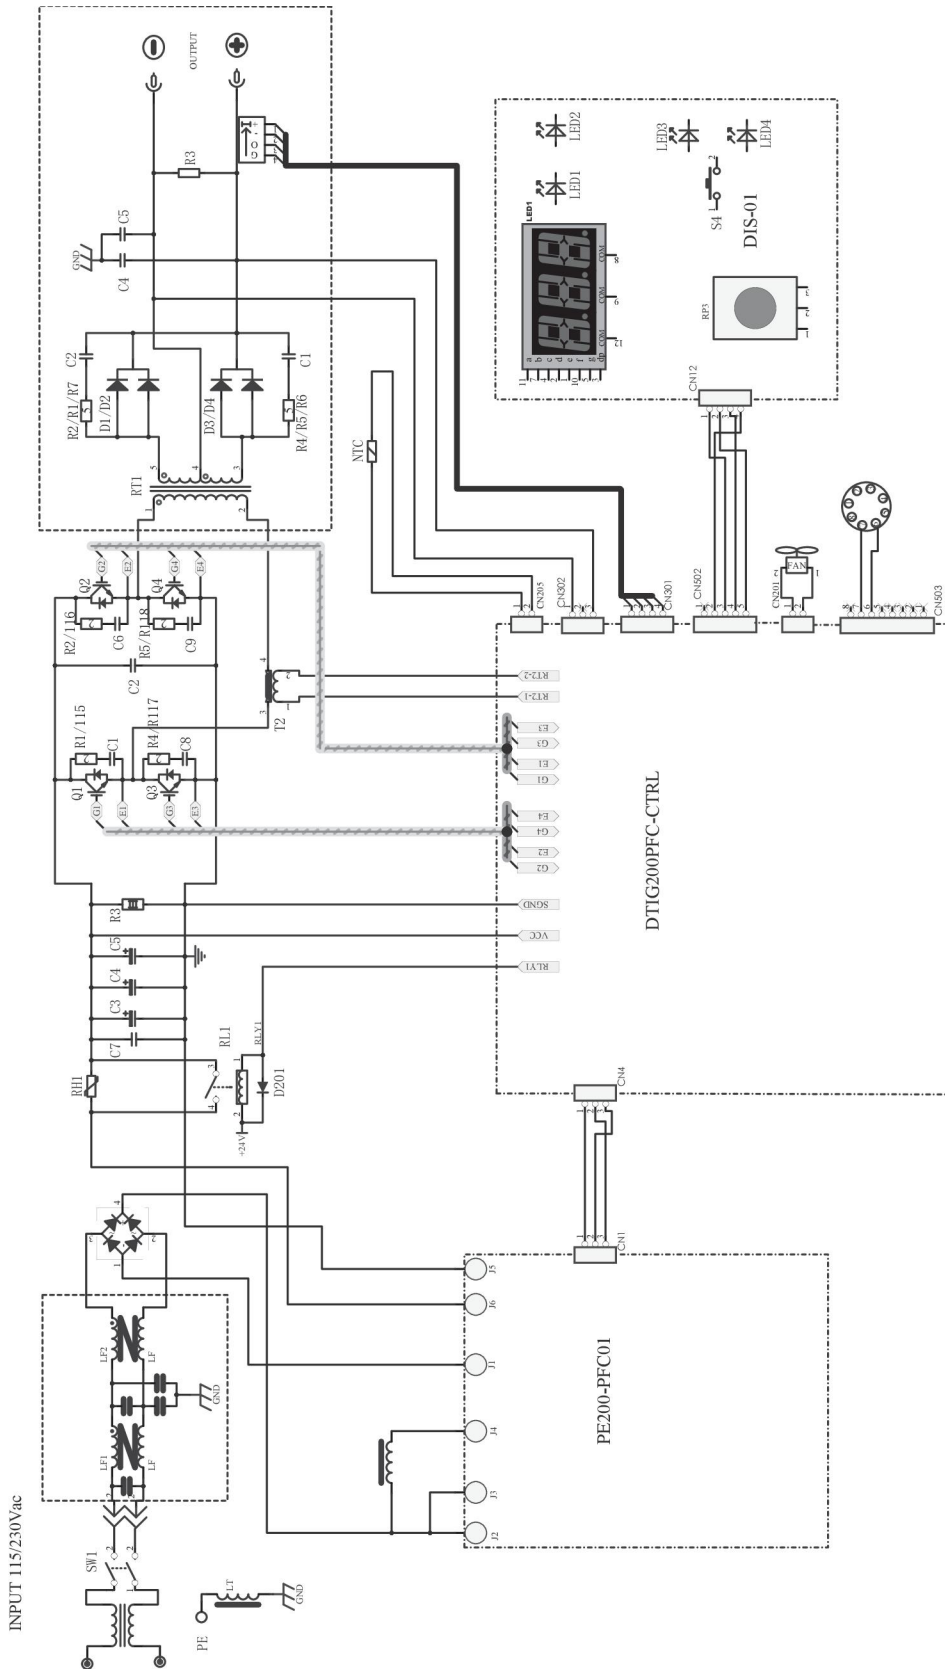
Repair and electrical work should be performed by an authorised ESAB service technician. Use only ESAB original spare and wear parts.

The **Rogue ES 180i Pro, ES 200i Pro** is designed and tested in accordance with the international and European standards **EN60974-1** and **EN60974-10**. On completion of service or repair work, it is the responsibility of the person(s) performing the work to ensure that the product still complies with the requirements of the above standards.


Spare parts and wear parts can be ordered through your nearest ESAB dealer, see esab.com. When ordering, please state product type, serial number, designation and spare part number in accordance with the spare parts list. This facilitates dispatch and ensures correct delivery.

DIAGRAM

From serial number A01-xxx-xxxx



ORDERING NUMBERS

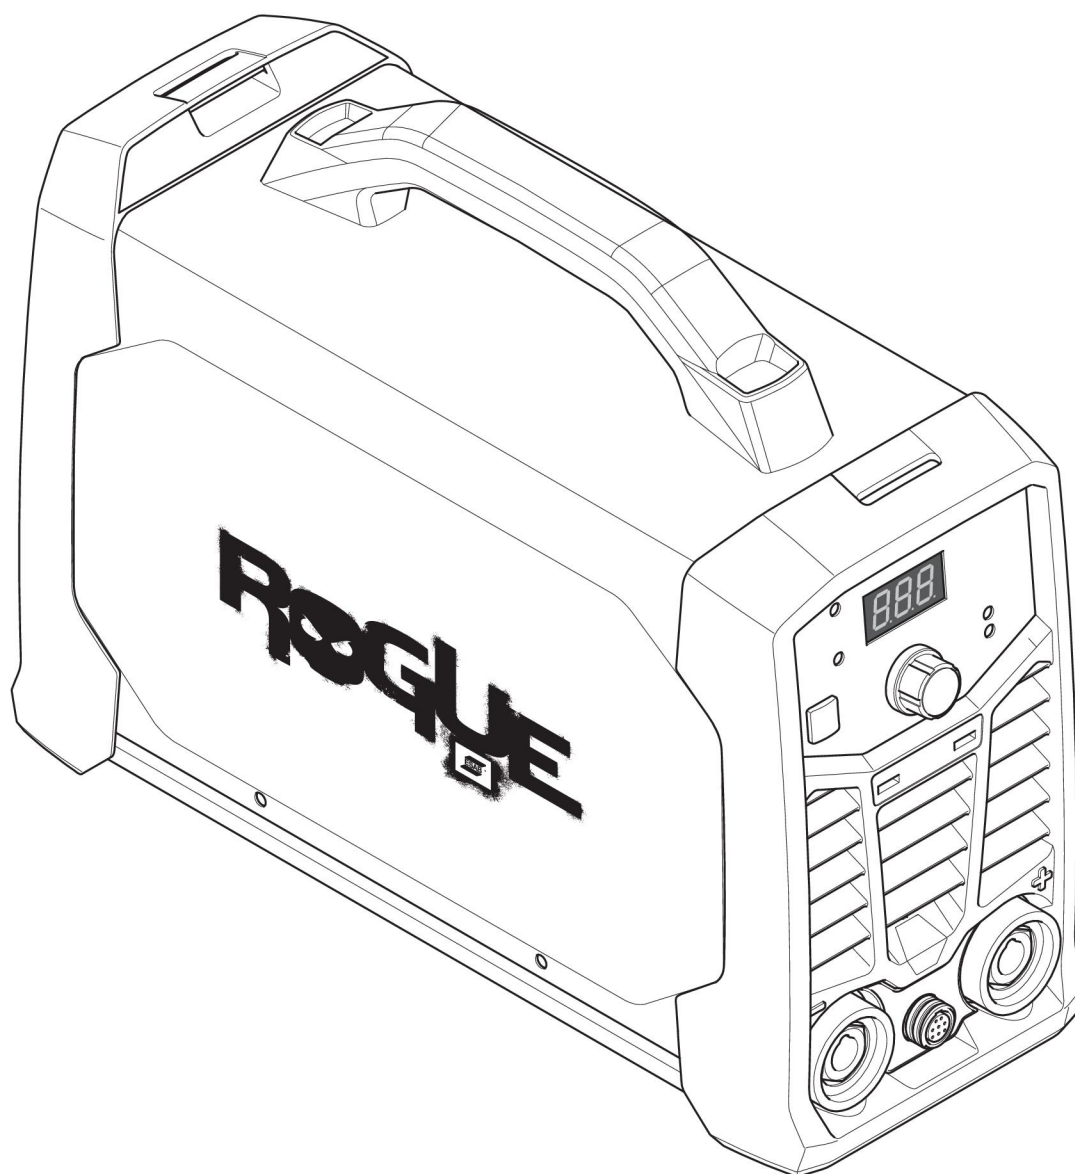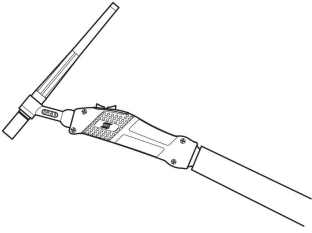
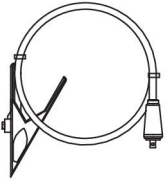
 
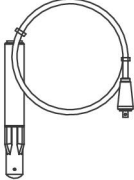
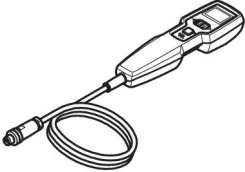
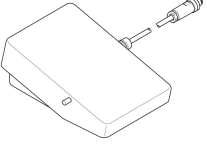

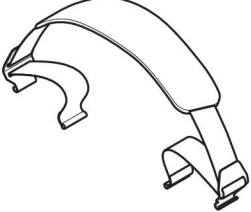


| Ordering number | Denomination | Type | Notes |
|-----------------|--------------------|-------------|-------------|
| 0700 500 078 | Power source | ES 180i Pro | Europe |
| 0700 500 079 | Power source | ES 200i Pro | Europe |
| 0700 500 082 | Power source | ES 200i Pro | Middle East |
| 0700 500 074 | Power source | ES 200i Pro | India |
| 0463 710 001 | Instruction manual | | |

Technical documentation is available on the Internet at: www.esab.com

The three last digits in the document number of the manual show the version of the manual. Therefore they are replaced with * here. Make sure to use a manual with a serial number or software version that corresponds with the product, see the front page of the manual.

ACCESSORIES

| | | |
|--------------------------|---|---|
| TIG torches | |  |
| 0700 025 514 | SR-B 17V, OKC 50, 4 m | |
| 0700 025 522 | SR-B 26V, OKC 50, 4 m | |
| Return cable kits | |  |
| 0700 006 889 | Return cable kit, OKC 50, 5 m | |
| 0700 006 903 | Return cable kit, OKC 50, 3 m | |
| 0160 360 881 | OKC 50 male cable connector, 1/0-4/0 cable (50 mm ²) EU |  |
| 0700 006 900 | Electrode holder Handy 200A with 25 mm ² , 3 m, OKC 50 |  |
| 0700 500 084 | Remote control, Handheld remote, MMA 4 |  |
| W4014450 | Remote control, Foot pedal, with 4,5 m (15 ft) cable, 8 PIN |  |
| 0700 500 085 | Rogue plastic case (Toolbox) |  |
| 0700 500 086 | Shoulder strap |  |



A WORLD OF PRODUCTS AND SOLUTIONS.



For contact information visit esab.com

ESAB AB, Lindholmsallén 9, Box 8004, 402 77 Gothenburg, Sweden, Phone +46 (0) 31 50 90 00

<http://manuals.esab.com>

